

Safety Data Sheet

Inweld Corporation.



1. PRODUCT AND COMPANY IDENTIFICATION:

PRODUCT NAME: HX904, HX905

MANUFACTURER: Inweld Corporation
3962 Portland Street
Coplay Pa 18037

EMERGENCY TELEPHONE NUMBER: 800-424-9300

2. HAZARD IDENTIFICATION:

Emergency Overview: This product is normally not considered hazardous as shipped. Avoid eye contact or inhalation of dust from the product. When this product is used in a welding process, the most important hazards are welding fumes, heat, radiation and electric shock.

Classification of the Substance/Mixture

CLP/GHS Classification (1272/2008):

Hazardous to the Aquatic Environment – Acute Hazard, Category 1

EU Classification (67/548/EEC):

This substance is not classified as dangerous according to Directive 67/548/EEC.

Labelling:



Symbols:

Signal Word: Warning

Hazard-determining components of labelling: Chromium

Hazard Statements:

H400 – Very toxic to aquatic life.

Precautionary Statements:

P261 – Avoid breathing dust/fume/gas/mist/vapours/spray.

P273 – Avoid release to the environment.

P280 – Wear protective gloves/eye protection/face protection.


P305+P351+P358 – IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

P391 – Collect spillage.

P402 – Store in a dry place.

P501 – Dispose of contents/container in accordance with local/regional/national/international regulations.

3. COMPOSITION / INFORMATION ON INGREDIENTS:

Chemical Identity	CAS #	Range %	OSHA PEL (mg/m3)	ACGIH-TLV (mg/m3)	Carcinogenicity	EU Classification (67/548/EEC)	CLP/GHS Classification (1272/2008)
Calcium Carbonate	1317-65-3	1-11	5 (as CaO)	10	No	Not Dangerous	Not Hazardous
#Chromium	7440-47-3	25-35	1.0 (Metal) .05 (Cr II & Cr III Compounds) 0.005(Cr VI)	0.5 ((Metal) 0.5 (Cr III Compounds) 0.05(Cr VI Soluble	Yes	Not Dangerous	(H400) Aquatic Acute 1 



SDS # 434
Latest Revision: November 2014
Page 2 of 7

Safety Data Sheet

Inweld Corporation.

			Compounds) 0.01 (Cr VI Insoluble Compounds)	Compounds)			
Calcium Fluoride	7789-75-5	1-5	2.5 (as F)	2.5 (as F)	No	(Xi) R36/37/38	(H315) Skin Irrit.. 2 (H319) Eye Irrit.. 2A (H335) STOT SE 3
Carbon	7440-44-0	1-5	15	10	No	Not Dangerous	Not Hazardous
Silica	14808-60-7	1-5	10	.025	Yes	(Xn) R48/20	(H373) STOT RE 2
Iron	7439-89-6	50-60	10 (as Fe2O3)	5 (as Fe2O3)	No	Not Dangerous	Not Hazardous

Important This section covers the materials of which the products manufactured. The fumes and gases produced during normal use of this product are covered in section 10. The term "Hazardous" in "Hazardous Material" should be interpreted as a term required and defined in OSHA Hazard Communication Standard 29CFR 1910-1200 and it does not necessarily imply the existence of hazard. The chemicals or compounds reportable by Section 313 of SARA are marked by the symbol #.

4. FIRST AID MEASURES:

Inhalation: Remove to fresh air immediately or administer oxygen. Get medical attention immediately.

Skin: Flush skin with large amounts of water. If irritation develops and persists, get medical attention.

Eye: Flush eyes with water for at least 15 minutes. Get medical attention.

Ingestion: Obtain medical attention immediately if ingested.

Electric Shock: Disconnect and turn off the power. Use a nonconductive material to pull victim away from contact with live parts or wires. Immediately contact a physician.

5. FIRE-FIGHTING MEASURES:

Suitable Extinguishing Media: Use water spray, alcohol-resistant foam, dry chemical or carbon dioxide. Welding arcs and sparks can ignite combustible and flammable materials. Use the extinguishing media recommended for the burning material and fire situation.

Unsuitable Extinguishing Media: Not applicable

Specific Hazards Arising From Chemical: Keep away from heat/spark/open flames/hot surfaces – No smoking. Chromium oxides, Hydrogen fluoride, Calcium oxide, Carbon oxides, Iron oxides

Protective Equipment: Fire fighters should wear complete protective clothing including self-contained breathing apparatus.

6. ACCIDENTAL RELEASE MEASURES:

Personal Precautions: Refer to section 8.

Environment Precautions: Refer to section 13.

Cleaning Measures: Solid objects may be picked up and placed into a container. Liquids or pastes should be scooped up and placed into a container. Wear proper protective equipment while handling these materials. Do not discard as refuse.


7. HANDLING AND STORAGE:

Precautions for Safe Handling: Handle with care to avoid stings or cuts. Wear gloves when handling welding consumables. Avoid exposure to dust. Do not ingest. Some individuals can develop an allergic reaction to certain materials. Retain all warning and identity labels.

Conditions for Safe Storage: Store in dry place in closed packages. Keep separate from chemical substances like acids and strong bases, which could cause chemical reactions.

8. EXPOSURE CONTROLS/ PERSONAL PROTECTION:

Engineering Controls: Avoid exposure to welding fumes, radiation, spatter, electric shock, heated materials and dust. Ensure sufficient ventilation, local exhaust, or both, to keep welding fumes and gases from breathing zone and general area.

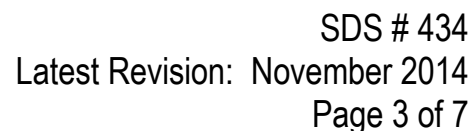

Inweld Corporation.

EN 12477: Protection gloves for welders

Skin protection: Heat-resistant protective clothing. Wear safety boots, apron, arm and shoulder protection. Keep protective clothing clean and dry. Clothing should be selected to suit the level, duration and purpose of the welding activity.

Class 1	
Impact of Spatter	15 Drops
Heat Transfer (radiation)	RHTI $24 \geq 7$ seconds
Process	<p>Manual welding with light formation of spatter and drops</p> <ul style="list-style-type: none"> • Gas Welding • TIG Welding • MIG Welding • Micro plasma welding • Brazing • Spot Welding • MMA Welding (with rutile-covered electrode)



SDS # 434
Latest Revision: November 2014
Page 4 of 7

Safety Data Sheet

Inweld Corporation.



Environmental Conditions	Operation of machines <ul style="list-style-type: none"> • Oxygen cutting machines • Plasma cutting machines • Resistance welding machines • Machines for thermal spraying • Bench welding
--------------------------	--

Class 2	
Impact of Spatter	25 Drops
Heat Transfer (radiation)	RHTI 24 ≥ 16 seconds
Process	Manual welding with heavy formation of spatter and drops <ul style="list-style-type: none"> • MMA welding (with basic or cellulose-covered electrodes) • MAG welding (with CO2 or mixed gases) • MIG Welding (with high current) • Self shielded flux core arc welding • Plasma cutting • Gouging • Oxygen cutting • Thermal spraying
Environmental Conditions	Operation of machines <ul style="list-style-type: none"> • In confined spaces • At overhead welding/cutting or in comparable constrained positions

9. PHYSICAL AND CHEMICAL PROPERTIES:

Appearance: Solid.

Color: Dark Brown 1298/ None

Odour: Odourless

Odour Threshold: Not Available

pH Value: Not Available

Melting Point/Melting Range: 1560 - 2000° F, 850 - 1100° C

Freezing Point: Not Available

Boiling Point/Boiling Range: Not Available

Flash point: Not Available

Evaporation Rate: Not Available

Self-in flammability: Not Available

Explosion limits: Not Available

Vapour pressure: Not Available

Vapour density: Not Available

Density at 20°C: Not Available

Relative density: 6-9 g/cm³


Solubility: Insoluble in water.

Partition coefficient: Not Available

Auto-ignition temperature: Not Available

Decomposition temperature: Not Available

Other Information: No available data.

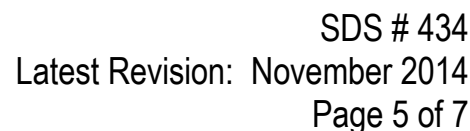


Inweld Corporation.




Refer to applicable national exposure limits for fume compounds, including those exposure limits for fume compounds found in section 3. Reasonably expected gaseous products would include carbon oxides, nitrogen oxides and ozone. Air contaminants around the welding area can be affected by the welding process and influence the composition and quality of fumes and gases produced.

Acute Effects: Overexposure to welding fumes may result in symptoms like metal fume fever, dizziness, nausea, dryness or irritation of the nose, throat or eyes. Prolonged inhalation of crystalline silica may result in silicosis, a disabling pulmonary fibrosis characterized by fibrotic changes and military nodules in the lungs, a dry cough, shortness of breath, emphysema, decreased chest expansion and increased susceptibility to tuberculosis. May cause sensitisation by skin contact.

LD/LC50 Values that are relevant for classification		
Iron 7439-89-6		
Oral	LD50	30000 mg/kg (rat)

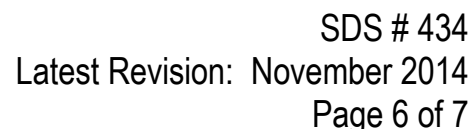

Inweld Corporation.



Welding materials could degrade into components originating from the materials used in the welding process. Avoid exposure to conditions that could lead to accumulation in soils or groundwater. Harmful to aquatic organisms, may cause long-term adverse effects in the aquatic environment.

Safety, health and environment regulations/legislation specific for the substance or mixture: Read and understand the manufacturer's instructions, your employer's safety practices and the health and safety instructions on the label. Observe any federal and local regulations. Take precautions when welding and protect yourself and others.



SDS # 434
Latest Revision: November 2014
Page 7 of 7

Safety Data Sheet

Inweld Corporation.

Warning: Welding fumes and gases are hazardous to your health and may damage lungs and other organs. Use adequate ventilation. Electric shock can kill. Arc rays and sparks can injure eyes and burn skin. Wear correct hand, head, eye and body protection.

Chemical safety assessment: No

USA: Under the OSHA Hazard Communication Standard, this product is considered hazardous. This product contains or produces a chemical known to the state of California to cause cancer and birth defects (or other reproductive harm). (California Health & Safety Code § 25249.5 et seq.) United States EPA Toxic Substance Control Act: All constituents of this product are on the TSCA inventory list or are excluded from listing.

EPCRA/SARA Title III Toxic Chemicals

The following metallic components are listed as SARA 313 "Toxic Chemicals" and potential subject to annual SARA reporting. See Section 3 for weight percentage.

Ingredient Name	Disclosure Threshold
Chromium	1.0 (Metal)

16. OTHER INFORMATION:

The information in this document is believed to be correct as of the date issued. However, no warranty is expressed to be implied regarding the accuracy or completeness of this information. This information and product are furnished on the condition that the person receiving them shall make his own determinations as to the suitability of the product for his particular purpose and on the condition that he assumes the risk of his use thereof.

This Material Safety Data Sheet complies with the EC directives 91/155/EEC and 93/112/EEC, including modifications 2001/58/EC.

Complies with OSHA Communication Standard 29 CFR 1910.1200 and Superfund Amendments and Reauthorization Act (SARA) of 1986 Public Law 99-499

Hazard Statements:

H315 – Causes skin irritation.

H319 – Causes serious eye irritation.

H373 – May cause damage to organs through prolonged or repeated exposure.

H400 – Very toxic to aquatic life.

R-Phrases:

R36/37/38 – Irritating to eyes, respiratory system and skin.

R48/20 – Harmful: danger of serious damage to health by prolonged exposure through inhalation.

S-Phrases:

S22 – Do not breathe dust.

S26 – In case of contact with eyes, rinse immediately with plenty of water and seek medical advice.

End of the document.